



FOR FIELD ASSISTANCE PLEASE CALL +1-213-255-2060 #4


- Before wiring to power supply and during servicing or relamping, turn off power at fuse or circuit breaker.
- · All servicing or relamping must be performed by qualified service personnel.
- Product must be grounded to avoid potential electric shock or other potential hazard.
- Product must be installed at locations and heights, in a manner consistent with its intended use, and in compliance with electrical code and local codes.


SAVE THESE INSTRUCTIONS FOR FUTURE REFERENCE




BOLT NOVA 500/750W STEM MOUNT



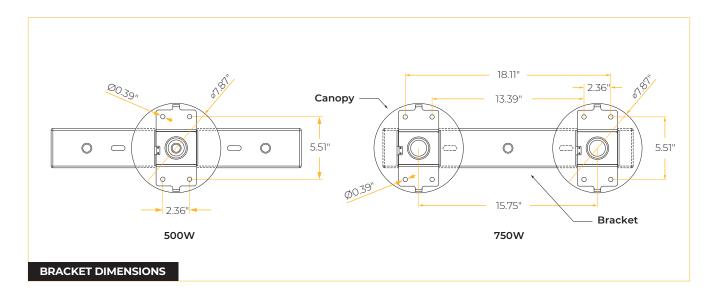


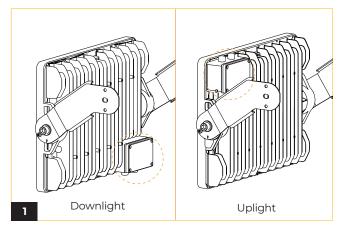


Ensure the light head is oriented in the desired direction, then tighten the screws securely to fasten it in place.

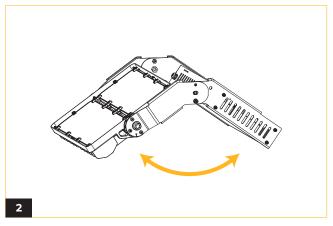

Unfold the luminare body until the screw points are aligned.

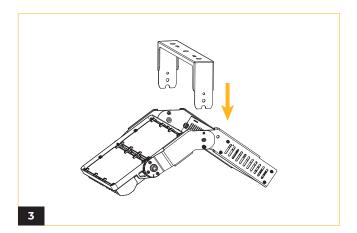


Align the bracket with the luminaire body.

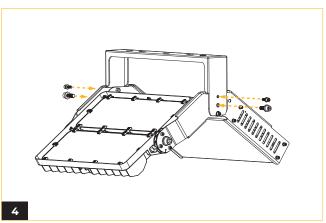


Fasten the bracket by using two screws on each side. Ensure that the unfolded body is also securely fixed and remains stable.

BOLT NOVA 500/750W STEM MOUNT




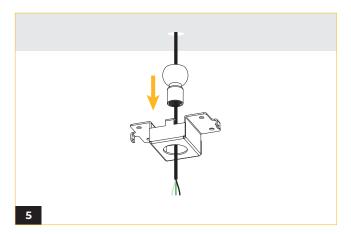


Affix the half ball by inserting it through the hole in the swivel crossbar. Proceed to thread the AC wires through both the half ball and the swivel crossbar.

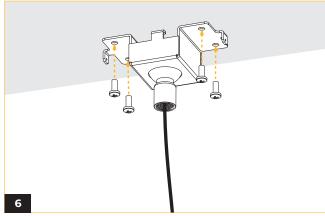


Mount the swivel crossbar onto a flat surface using screws.

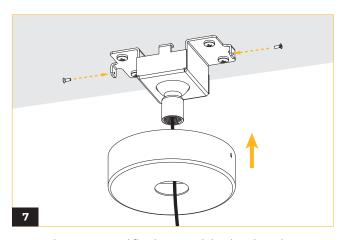


Mount the canopy and firmly secure it in place by using screws on both sides.

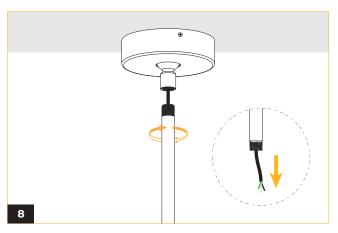

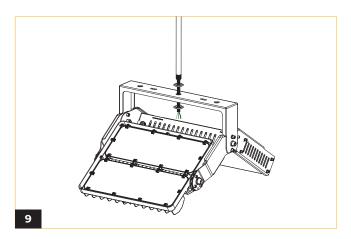


Secure the bracket onto the stem using hex nuts.

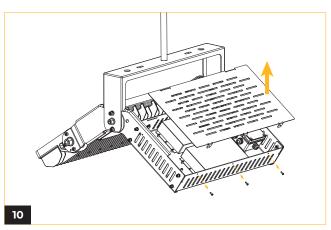


Gain access to the power box by removing three screws located on the bottom.

BOLT NOVA 500/750W STEM MOUNT




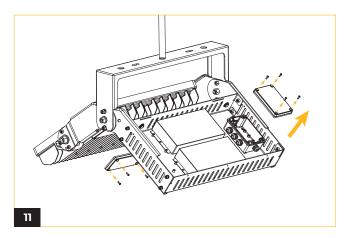


Detach the lid of the waterproof junction box by unscrewing the four screws.

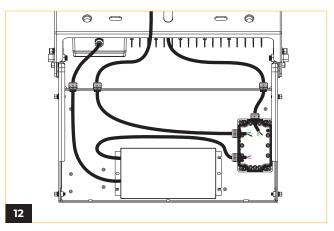


Thread the AC wire and DMX wire through the cable gland into the junction box. Establish electrical connections between the junction box and the fixture. (Refer to wiring diagram)

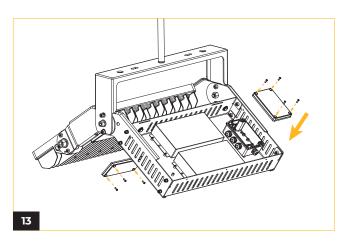

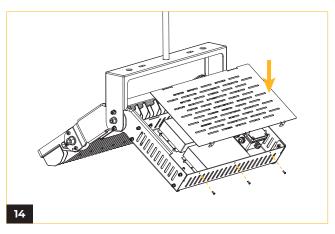

Reattach the power box cover by securing it with the three screws located on the bottom.

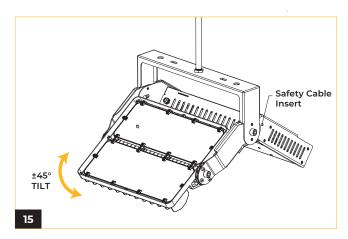


The light engine can be adjusted within a range of ± 45 degrees. To secure the rotated position, tighten the screws on each side.

BOLT NOVA WIRING DIAGRAM




WIRING DIAGRAM

DMX

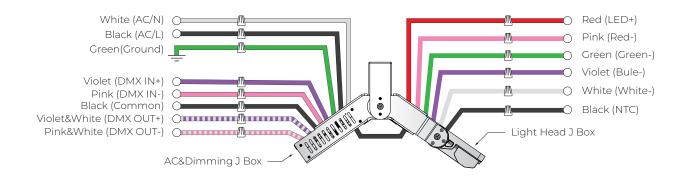

DALI

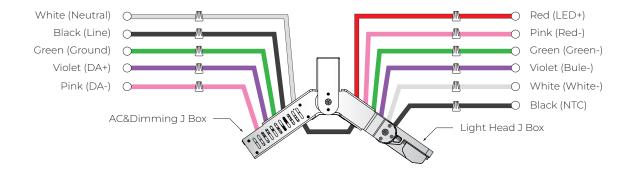

INSTALLATION GUIDE BOLT NOVA



N	0	Т	Ε	S
---	---	---	---	---

Application note: Wiring for DMX/RDM lighting systems

DMX/RDM is a robust and reliable system for lighting control. However, if not implemented correctly, problems can arise such as random flashing of lights, erratic operation and delays in responding to commands. This document explains the best practices in DMX wiring.

Important things to consider are:

- 1. DMX is a three-wire system. Use all three!
- 2. DMX is based on the EIA-485/RS-485 standard.
- 3. Always use cable specifically designed for DMX / RS-485. These cables have an impedance of 120Ω and a low capacitance. For instance: Belden 3106A.
- 4. DMX must be terminated with a 120Ω resistor to prevent reflections.
- 5. A daisy chain topology should be used.
- 6. After 32 unit loads a repeater/booster should be used. (Important: For Tunable White fixtures, After "32" unit loads a repeater/booster should be used.)
- 7. Keep cabling below 200 meters between the controller and the last driver.
- 8. It is generally considered good practice to provide separate DMX in and DMX out / DMX Thru connections to your fixture to aid in installation. This can be in the form of pigtails, RJ-45 connectors or 5-pin XLR connectors.
- 9. Use twisted pair cables with an impedance of 120Ω and a low capacitance.
- 10. UTP Cat5 or Cat6 network cable can also be used but have a slightly lower impedance of 100Ω .
- 11. If shielded cable is used, only connect shield to ground on one side (typically, the controller should have its shield terminal connected to ground).
- 12. Not following the above recommendations may seem to work at first, but can cause problems. Sometimes after weeks of seemingly normal operation.