




IMPORTANT SAFETY INFORMATION. **READ AND FOLLOW ALL SAFETY INSTRUCTIONS**

IMPORTANT SAFETY INFORMATION. READ AND FOLLOW ALL SAFETY INSTRUCTIONS. Before wiring to power supply and during servicing or relamping, turn off power at fuse or circuit breaker. All servicing or relamping must be performed by qualified service personnel. Product must be grounded to avoid potential electric shock or other potential hazard. Product must be at locations and at heights and in a manner consistent with its intended use, and in compliance with Electrical Code and local codes.

SAVE THESE INSTRUCTIONS FOR FUTURE REFERENCE.

0-10V / Triac / ECO

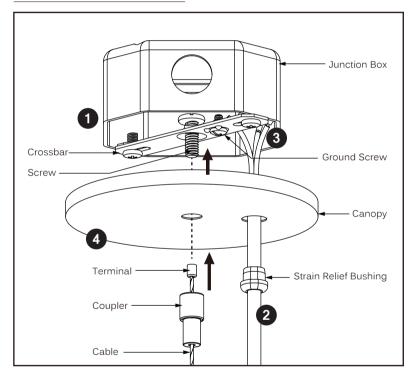

Step 1

Secure the crossbar to the 4" octagonal box (by others) designed to support the weight of the fixture.


Lock the strain relief bushing to the power cord with allowance for wiring connections, and thread the power cord through the canopy wire hole.

Connect the Green ground conductor to the ground screw on the crossbar, the line voltage to the Black conductor, and the neutral to the White conductor. For 0-10V dimming option, connect the two remaining conductors (Date+ to Purple conductor and Data- to Gray conductor).

* Make all connections with UL approved connectors.

Thread the cable through the coupler with the terminal side on top. Slide the coupler up to the canopy and secure with the screw on crossbar.



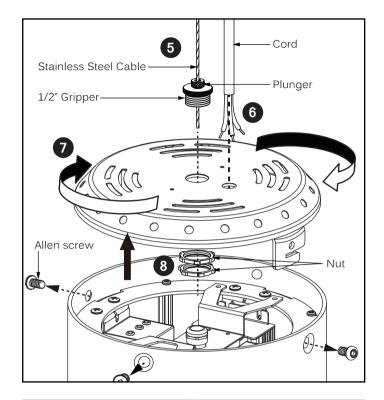

Step 5

Insert the cable through the gripper and plunger. Trim off extra cable using cable cutting tool.

To adjust the cable to desired length, press the plunger.

Step 6


Feed cord through the lid.

Step 7

Loosen four Allen screws on the side of fixture. Twist and remove the lid from cylinder fixture.

Step 8

Screw gripper to two nuts under the lid.

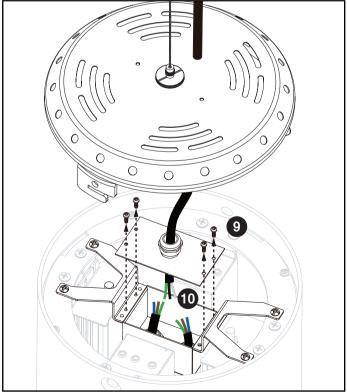

Step 9


Loosen four screws on the hub box. Pull the AC cable thru the cable gland.

Step 10

Make appropriate wire connections, see Wiring Diagram for instructions.


* Make all connections with UL approved connectors.



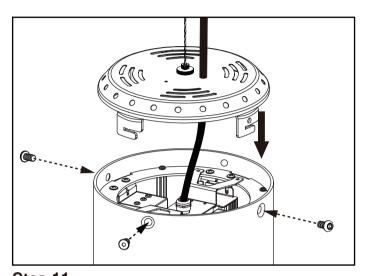

Step 11 Tighten four screws on the hub box. Attach cylinder fixture to lid and secure Allen screws.

DMX

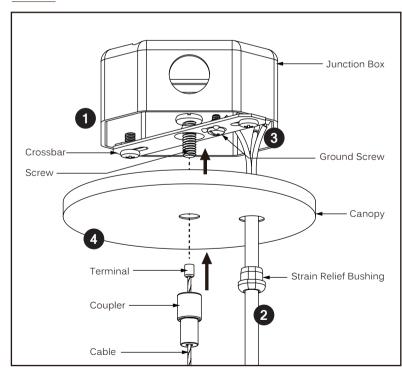

Step 1

Secure the crossbar to the 4" octagonal box (by others) designed to support the weight of the fixture.

Step 2

Lock the strain relief bushing to the power cord with allowance for wiring connections, and thread the power cord through the canopy wire hole.

Step 3


Connect the Green ground conductor to the ground screw on the crossbar, the line voltage to the Black conductor, and the neutral to the White conductor. For 0-10V dimming option, connect the two remaining conductors (Date+ to Purple conductor and Data- to Gray conductor).

* Make all connections with UL approved connectors.

Step 4

Thread the cable through the coupler with the terminal side on top. Slide the coupler up to the canopy and secure with the screw on crossbar.



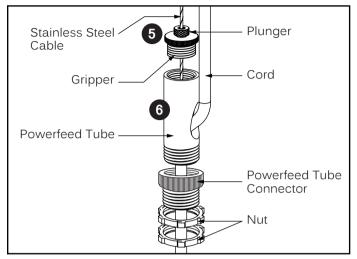


Step 5

Insert the cable through the gripper and plunger. Trim off extra cable using cable cutting tool.

To adjust the cable to desired length, press the plunger.


Step 6

Fasten Powerfeed tube and Powerfeed tube connector. Secure gripper with Powerfeed tube, then feed cord through Powerfeed tube.

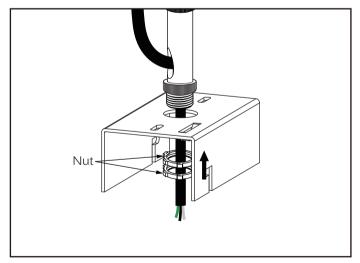

Step 9

Secure the Powerfeed Tube Connector and upper mounting bracket using a 1/2 nut.

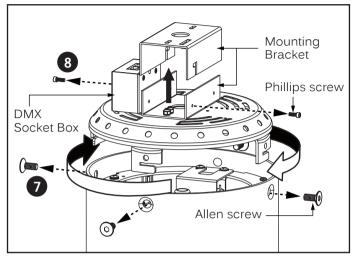


Step 7

Loosen four Allen screws on the side of fixture. Twist and remove the Top Plate from cylinder fixture.

Step 8


Loosen the two phillips screws on the side of the mounting bracket and remove it.

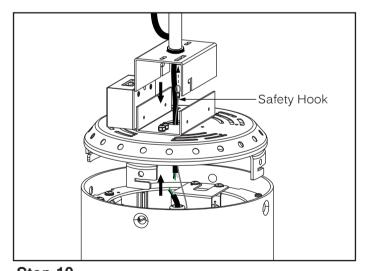

Step 10

Route AC cable and safety hook through the Top Plate side hole, and connect the power wires to wires from the fixture (see P7 for circuit diagram).



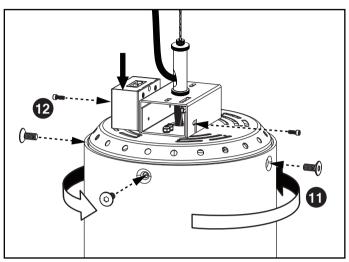

Step 11


Fasten Top Plate to fixture until it latches on Top Plate and the inside fixture is aligned, and screw the four Allen screws on the side of fixture.

Step 12


Insert the mounting bracket, and screw the two phillips screws on the side of the fixture, finaly secure the safety hook.




Wiring Diagram Note: 180W/220W use two power cable.

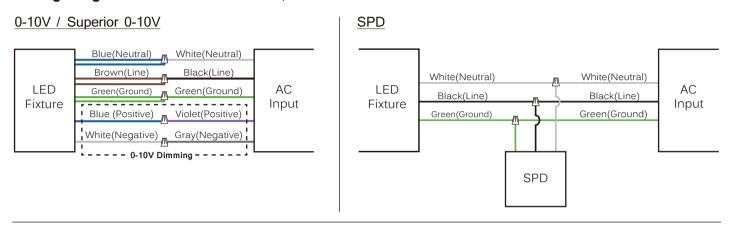

Superior 0-10V Tunable White

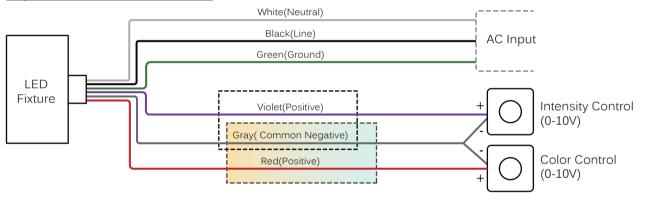


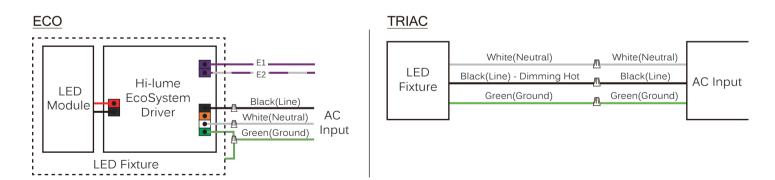





Wiring Diagram

DMX



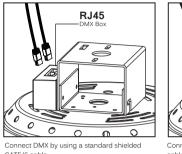

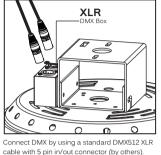

*The last fixture has to be terminated with a DMX Terminator (by others).

Application note: Wiring for DMX/RDM lighting systems

DMX/RDM is a robust and reliable system for lighting control. However, if not implemented correctly, problems can arise such as random flashing of lights, erratic operation and delays in responding to commands. This document explains the best practices in DMX wiring.

Important things to consider are:

- 1. DMX is a three-wire system. Use all three!
- 2. DMX is based on the EIA-485/RS-485 standard.
- 3. Always use cable specifically designed for DMX / RS-485. These cables have an impedance of 120Ω and a low capacitance. For instance: Belden 9841 or 3105a.
- 4. DMX must be terminated with a 120Ω resistor to prevent reflections.
- 5. A daisy chain topology should be used.
- 6. After 32 unit loads a repeater/booster should be used. (Important: For tunable white fixtures, After "32" unit loads a repeater/booster should be used.)
- 7. Keep cabling below 200 meters between the controller and the last driver.
- 8. It is generally considered good practice to provide separate DMX in and DMX out / DMX thru connections to your fixture to aid in installation. This can be in the form of pigtails, RJ-45 connectors or 5-pin XLR connectors.
- 9. Use twisted pair cables with an impedance of 120Ω and a low capacitance.
- 10. UTP Cat5 or Cat6 network cable can also be used but have a slightly lower impedance of 100Ω .
- 11. If shielded cable is used, only connect shield to ground on one side (typically, the controller should have its shield terminal connected to ground).
- 12. Not following the above recommendations may seem to work at first, but can cause problems. Sometimes after weeks of seemingly normal operation.